


ROZMIESZCZENIE ELEMENTÓW NA PŁYTCIE BAROMETRU

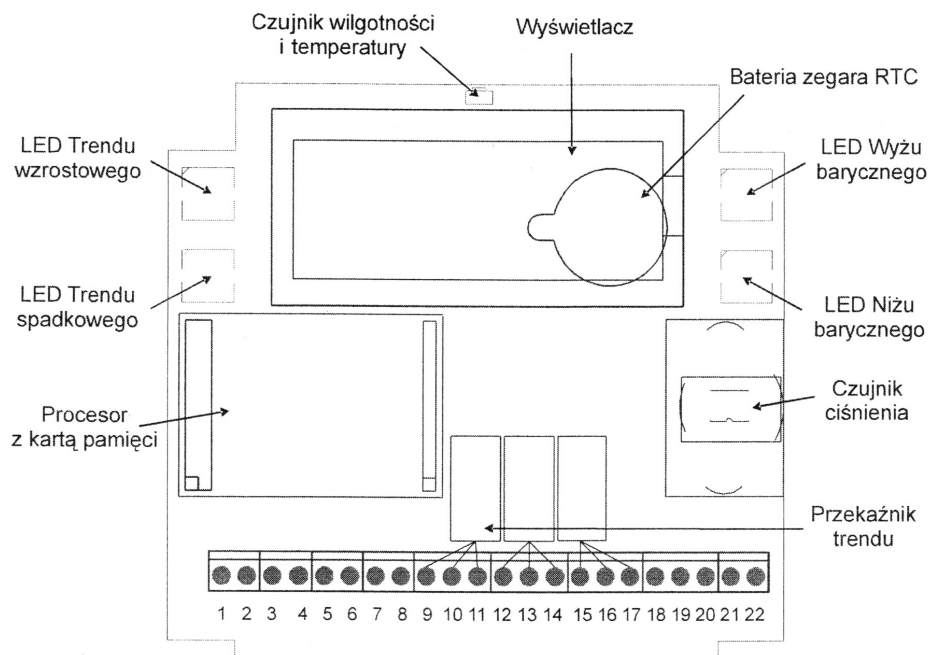

OPIS LISTWY ZACISKOWEJ BAROMETRU

1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20	21	22
1. USB (Pin1 - VCC)	2. USB (Pin2 - DM)	3. USB (Pin3 - DP)	4. USB (Pin4 - GND)	5. RS232 (Pin5 - GND)	6. RS232 (Pin3 - TX)	7. RS232 (Pin4 - DTR)	8. RS232 (Pin2 - RX)	9. PR1 (NO)	10. PR1 (NC)	11. PR1 (COMM)	12. PR2 (NO)	13. PR2 (NC)	14. PR2 (COMM)	15. PR3 (NO)	16. PR3 (NC)	17. PR3 (COMM)	18. 1-Wire (+5V)	19. 1-Wire (Dane)	20. 1-Wire (Masa)	21. Zasilanie (Masa)	22. Zasilanie (+12V)